INDUSTRIAL MEASURING INSTRUMENTS

#### \*\* Inquiry \*\*

controller, please contact your shop where purchased, or our agent. For any inquiry of this controller, after checking the following as to the

Power source voltage ..... Kinds of input ..... Temperature specification ..... [Example] PC-635-A/E J.00t 01 0 AC 110/220V

Please let us know the details of malfunction of the instrument, if any, and the operating conditions specifically on job site.

### SHINKO TECHNOS CO., LTD. **OVERSEAS DIVISION**

Reg Office : 2-48, 1-Chome, Ina, Minoo, Osaka, Japan Telephone : (0727)21-2781 & 2782 Mail Address: P.O.Box 17, Minoo, Osaka, Japan

FAX : (0727) 24-1760 Cable: SHINKO MINOO JAPAN

NaPC61E8 2000.09

SHINKO TECHNOS CO., LTD. OSAKA, JAPAN

#### STATE

INDUSTRIAL MEASURING INSTRUMENTS

## INSTRUCTION MANUAL

FOR

MICROCOMPUTER BASED PROGRAMMABLE TEMPERATURE CONTROLLER

PC-600 SERIES



the lower side of the inner equipment. and specifications of the instrument, peruse this instruction manual before operation. For your information, the model of this instrument is manifested on exact quality control in our factory. Further to confirmation of the model name Thank you for purchasing our Programmable Temperature Controller, PC-600 series. This instrument is delivered after its production and inspection on the basis of

who uses the instrument at site. Make sure to hand over this instruction manual to the hand of the operator

SHINKO TECHNOS CO., LTD. OSAKA, JAPAN

Shinha

• • • Notes to users • • • Before operating this controller, you should understand about following matters.

< Warning > —
Turn the power supplied to the instrument OFF before wiring or checking. If working or touching the terminal on the power ON status, there is a possibility of Electric Shock which can cause severe injury or death.


ment must be grounded.

• Do not apply the voltage between the terminals  $\overline{\mathcal{O}}$  and  $\overline{\mathbb{G}}$  (See page 6), or there is a possibility that the transformer can be burning.

7.	6.1 6.2	5.		4.2 4.1	3.3 3.3 3.3	2.1 2.3 2.3	1.1
Flow of basic operation14	Explanation of function       10         Explanation of display function       10         Explanation of key function       12         (1) Keys used at setting (Program keys)       12         (2) Keys used at operation       12	Operating principle 9	t terminal for instrument, and Ground terminal for instrument, and Ground terminal terminal tiput terminal itput terminal sting input suission output cation	Wiring connection 5 Terminal arrangements 5 Example of wiring 6	3. Hounting to control panel       5         3.1 Selection of location       5         3.2 Panel cutout       5         3.3 Dimensional outline drawing       5	Before use	- CONTENTS - 4 Explanation of model names 4 Standard model names 4 Optional specifications 4

## 1. EXPLANATION OF MODEL NAMES

1.1 Standard model names

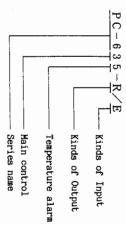

- E: Thermocouple, R: RTD, A: DC current and V: DC voltage
- Relay contact, S: Non-contact voltage
- ∄ ಔ Non-contact relay and A: DC current
- 5: High and Low limit alarm with low limit standby
- PC-600 series 3: PID action

1.2 Optional specifications

		A CH POTO A CARACA
of power failure and turns to hold status.		from nower failure
After restored, executes the program at the time	PRH	Hold function after restored
restored.		from power failure
Turns to standby status after the power failure	PS	Stop function after restored
Begins the start of program at PV value.	PST	PV starting form
at once.		
After the power turned ON, starts the program	AST	Automatic starting form
Transmits the data by EIA RS-485.	ડ	Serial communication interface
Transmits the data by EIA RS-232C.	C	Serial communication interface
DC 0 to 1V.		output
Setting value transmitting output DC 4 to 20mA or	SVT	Setting value transmitting
output DC 0 to 1V or DC 4 to 20mA.		output
Process variable (actual temperature) transmitting	PVT	Process variable transmitting
7 circuits, open collector, capacity DC 24V max.50mA	TS	Time signal output
(or by open collector).		
Operatable various functions closing the contact	EC	External control function
High limit standby of temperature alarm is applied.	WH	High limit standby applied
Low limit standby of temperature alarm not applied.	LN	Low limit standby not applied
Acts the temperature alarm set by process value.	AA	Process value alarm setting
that.	9	COOTING CONCLOT SECTION
OFF in the range in which the input value is lower than the setting value. ON in the range higher than	2	Cooling control action
		display
Displays the Step temperature programmed.	SS	Step temperature setting value
Description	Code	Optional name

[Optional code indication]

Specify the optional codes mentioned above following the model names. When two or more functions specified, delimit with comma.

Note: Following optional specifications can not be applied with each other. (i.e. Only one function in each item can respectively be applied.)

- 1. Process variable transmitting output (PVT) and Setting value transmitting output (SVT).
- ? Automatic starting form (AST), Stop function after restored from power failure (PS) and Hold function after restored from power failure (PRH).
- Ψ Serial communication (C) and (C5).

Unpacking BEFORE USE Shinho

- Unpack with great care not to shock the instrument
- 2.2 Checking instrument and accessories

Confirm following accessories: Mounting bracket, 1 set Check whether the appearance has any trouble (damage) or not. Operation flow chart 3 copies Instruction manual, 1 c

2.3 Confirmation of specifications


and the rated range is shown on the front face of the instrument. The model name of this instrument is manifested on the lower side of the inner equi

- MOUNTING TO CONTROL PANEL
- 3.1 Selection of location


Mount the controller in a location with:


- A minimum of dust and an absence of corrosive gases An ambient humidity is not high.
- An ambient temperature is within 0°C to 55°C.
- No exposure to direct sunlight.
- The controller is away from the electromagnetic switch of large capacity or wir Neither mechanical vibration nor shock through which large current flows.

# 3.2 Panel cutout

 

4. WIRING CONNECTION

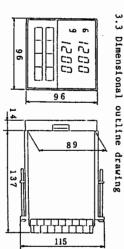

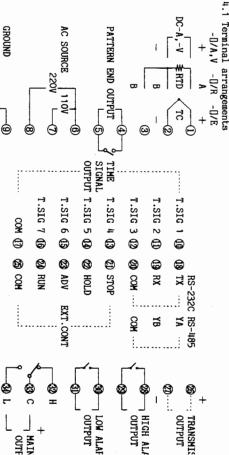

(Terminals indicated within dot line are arranged at the optional -R/specifications, no terminals are applied if the option is not applied.)

Fig. 4.1 Terminal arrangements

-S,T,A/[

Shirte

### 4.2 Example of wiring

## (1) Control output terminal

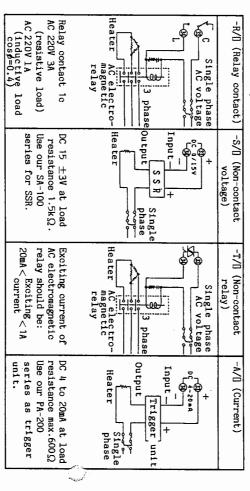


Fig. 4.2 Examples of wiring for control output terminals

# (2) Power source for instrument and Ground terminals


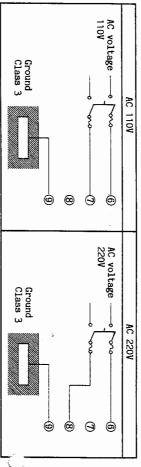


Fig. 4.3 Wiring examples of power source for instrument and Ground terminal

#### Notes:

- 1. Power switch is not provided for this instrument. Therefore, both power switch and fuse (220V 2A) should be provided on the external circuit near this instrument.
- 2. Ground without fail, and use the wire as thick as possible.
- With relay contact type of controller, auxiliary relay should be provided on the external of this instrument to protect the built-in relay.
- 4. To prevent the instrument from a bad influence owing to the unexpected level noise, it is recommended that the surge absorber be provided between the coil of the external relay.
- 5. For the improvement of the withstand noise, a noise filter is set between the power source circuit and ground terminal. (Leak current AC 200V lmA)
- 6. Voltage must not be applied to the terminals between (7) and (8)

#### (3) Input terminal

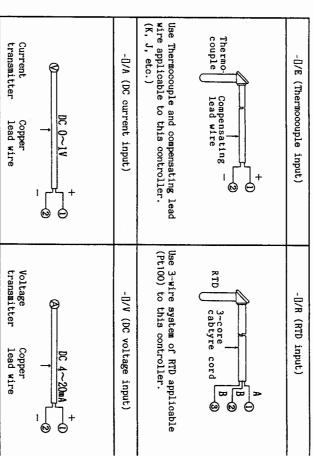

Note: To avoid the influence of noise, keep input signal wire of thermocouple, RTD, I current or DC voltage away from power source line for the instrument and the lo

Fig. 4.4 Example wiring for input terminal

### (4) Alarm output terminal

 


Fig. 4.5 Alarm output terminals

### (5) Pattern end output terminal Pattern end outputs when the final step of program terminated To cancel the output, press (MAR) key.

 


Fig. 4.6 Pattern end output terminals

# (6) Time signal output terminals (Option code: TS)

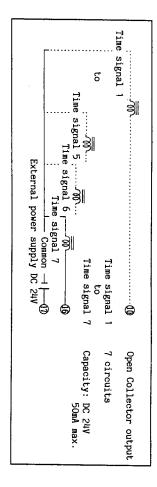


Fig. 4.7 Pattern end output terminals

- (7) External operating input (Option code: EC)
- (8) External transmission output (Option code: PVT, SVT)
- (9) Serial communication (Option code: C, C5)

Communication RS-485, RS-23; Serial

RS-232C

input Open collector Contact input transmission output External

+ instrument Receiving (9-YB-RX-B-YA-TX-COM computer Personal

Fig. 4.8 External operating input

Fig. 4.9 External transmission output and Serial Communication

### OPERATING PRINCIPLE

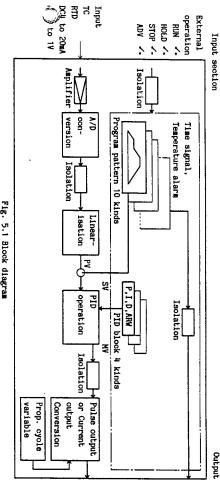


Fig. 5.1 Block diagram

(MV) operated by PID is converted into the switching signal or the current signal and is of the specified pattern No. (operated at any time by the specified temperature and time by pulse conversion circuit. operated by PID together with A/D conversion and PV value linearised. The manipulating vi operation becomes RUN situation by key operation or External operation input. Then, operation input and Fixed value control, besides its original controlling functions. patterns and 10 steps per pattern (total 100 steps), and it has many functions such as E Block diagram of this instrument is shown on Fig 5.1. This instrument is a digital programable controller based on a microcomputer. This instrument can store 10 kinds of program The action is: Program, such as Pattern setting or PID setting, which has been set by ke

Explanation of words

Pattern Program composed of several steps.

Step PID block Smallest unit which sets time and temperature.

Aggregate of four parameters: P (Proportional band), I (Integral time), D (Derivative time) and ARW (Anti-reset windup).

Processing time: The rest of time on control execution.

Processing

temperature Temperature of process performed. (Input temperature)

: The function which waits for the next step until the deviation between processing temperature and the final setting value at the end of a grad step has been within Wait setting value. At that time, the progress of

The function which stops processing time during execution of control. programming time is suspended.


ADV (Advance) It skips per step unit and carries forward a program of control.

The function which can set an optional time (OFF time and ON time) It repeats the execution per pattern unit. (After the termination of linked patterns when linked.) <u>a1</u>]

Temperature Time signal within a total time range of set pattern and can output time signal.

It can be set to each (individual) step. Individual set for both high ar exceeds the setting range. low limit. The function which outputs signal when processing temperature

### 6. EXPLANATION OF FUNCTION

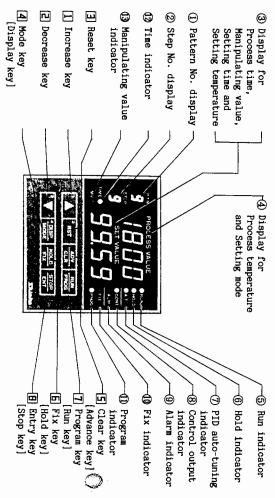

Notes: (1) [ key] is used when operation mode.

(2) The content of display is changed on the setting mode. As for the details, refer to each item.

Fig. 6.1 Explanation of Front function

# 6.1 Explanation of display function

0

Display	Nаше	Explanation of function
① 5 Red LED lights	Pattern number	Shows pattern number on Pattern number display (No.0 to 9)
© <b>8</b> Green LED lights	Step number	Shows step number on Step number display (No.0 to 9)
② <b>8</b> Green LED blinks	Wait indication waiti	Indicates that the program control is being waiting. (Indicates on Step number display.)

Shinho

### PC-600 INSTRUCTION MANUAL

	Red Ped Red Red	Red © Red Red &		Red LED light.  A Red LED light.  A BBBB Red LED lights  B C RUN Red LED lights  B O HOLD Red LED blinks  Tellow LED bli  B C CONT Green LED ligh
о птартау	«In setting mode» Setting mode Shows display Run indicator Shows	Settin displa Run ind Hold in	Settin displa displa Run ind Run ind PID aut indicat	Settin displa displa Run ind Run ind Indicat Indicat
Lights when thermocouple or RTD burnout. (Light	when thermocouple or RTD burnout. hen input exceeds 112.5% of rated when input exceeds 112.5% of rated when input exceeds 112.5% of rated that the program is running.	when thermocouple or RTD burnout. hen input exceeds 112.5% of rated the name of the characters on settence that the program is running. that the program time is suspended.	when thermocouple or RTD burnout. hen input exceeds 112.5% of rated the input exceeds 112.5% of rated the mode by the characters on settent the program is running. that the program time is suspended that the program of PID auto-tuning. prminated, it turns to unlit.	when thermocouple or RTD burnout. hen input exceeds 112.5% of rated the input exceeds 112.5% of rated the mode by the characters on settenthat the program is running. that the program time is suspended. that the program time is suspended. the execution of PID auto-tuning. serminated, it turns to unlit. s when the control action (control lowever, with -A/[] type, it blinks output.)
		® ○ HOLD Hold indicator Shows that the program time	(B) O HOLD Red LED blinks Hold indicator Shows that the program time Red LED blinks  (T) O AT indicator Shows that the program time Shows that the program time Shows that the program time When terminated, it turns to	© HOLD Red LED blinks Hold indicator  Red LED blinks PID auto-tuning Shows the execution of PID auto-tuning. Yellow LED blinks Shows the execution of PID auto-tuning. When terminated, it turns to unlit.  © CONT Control output indicator UN. (However, with -A/∏ type, it blinks to the output.)

Display  O FIX Red LED lights  O PROG Red LED lights  O TIME Red LED lights	Name Fix indicator Program indicator Time indicator	Explanation of function  Shows the fixed value control status.  Shows the program value control status.  Shows that the step time remaining is being displayed.
① O PROG Red LED lights	Program indicator	Shows the program value control status.
① O TIME Red LED lights	Time indicator	Shows that the step time remaining is b displayed.
⊕ MV     Red LED lights	Manipulation indicator	Shows the manipulating value status on SV value.

6.2 Explanation of key function
(1) Keys used when setting (Program keys)
It turns to setting mode by pressing keys in the order of [], FT, Fxx, EXEL.

7	<u> </u>	<u>5</u>	4	3 SRST	<b>A</b> 3	( <b>*</b> .	Кеу	
5)	LE .		Man	-				
Program key	Fix key	Clear key	Mode key	Reset key	Decrease key	Increase key	Name	
	Cha (Si	Cle	Swi (Si	Ret (Si				
Changes the mode to the program control. (Simultaneously, it registers the numeric value.)	Changes the mode to the fixed value control. (Simultaneously, it registers the numeric value.)	Clears the program. Note: This key should be pressed 3sec. or more.	Switches the setting mode. (Simultaneously, it registers the numeric value.)	Returns the setting mode to the standby mode. (Simultaneously, it registers the numeric value.)	Decreases the numeric value.	Increases the numeric value.	Explanation of function	


Shinho

PC-600 INSTRUCTION MANUAL

## (2) Keys used when operation

•	7	<u>6</u>	<u>[5</u>	4	
199F	Five:	1998.E	(ARK)	HOSE!	Key
Stop key	Run key	Hold key	Advance key	Display key	Name
Stops the program being executed.  Otherwise, cancels the pattern end output signs at the termination of final step of the program of the program of the section of the program of the section of the program of the section of the program of the pro	Starts the Program or cancels the Hold.	Interrupts the program time being executed. As for control, fixed value control is execute with the value at that time.	Interrupts the program step being executed and moves to the next step.	Switches SV display into the Setting temperatuvalue → the Remaining step time → the Manipulating value → the Setting temperature value	Explanation of function

Note: Press (ANN) key to run the program, however, it starts from the beginning of the program pattern. To start the program from the middle of the pattern, or to on the pattern end signal, press (ANN) key to advance the step.

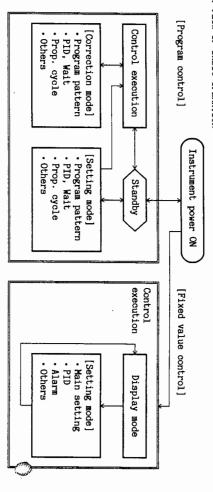

executing. (However, the number of Repeat during control cannot be changed, although the setting value for the number of Repeat can be changed.) When the setting lock is not designated, program can be corrected even if the control is

Selection of the "Program control" and the "Fixed value control".

- Change the situation into setting mode by pressing key according to the order of [▼▼], (BSS).
- (2)-1 The program control (when PROG lamp lighted) can be changed into the fixed value control by further pressing [HYE] key.
- (2)-2 The fixed value control (when FIX lamp lighted) can be changed into the program control by further pressing [HIN] key.


### 8. HOW TO SET PROGRAM

Shinbo

- 8.1 Before key operations

  Make the data before starting the setting. Arrange the data on data table to enter pattern programming on the graph table.
- (1) For the graph table, put the temperature [°C] on vertical line and the time [hour: minute] on horizontal line.

- (2) Plot in order from the data of step 0, and connect the plot.
  (3) Enter each block No. of PID, Wait and Alarm.
  (4) Enter the block No. at the position of necessary channel No. in the time signal [0] (Applicable to only in case the option is designated.)
- It is possible to set up to 10 steps per pattern, each 10 blocks for PID, Wait and Al block, 16 time signal blocks and 7 circuits for channel. However, the following data abridged to make the example simply.
- 8.2 Data example
- (1) Program pattern (Example: Pattern No. 9

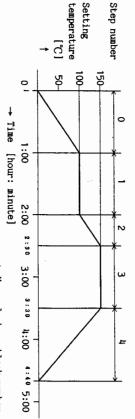

Z

										_				
				arguar	Time							number	D1 aak	
Number	Signal CH7	Number	CH3	e i amo	Number	CHZ	Cignol	Number	CH1	Signal	Alarm	Wait	PID	
					0	0/0		5	20/80		-	_	_	
					2	0 / 6 0		3	0/75		2	0	2	
					0	0/0		2	0/60		_	2	-	
	-				14	20/20		1	30/30		ω	0	3	* Numera
					3	0/75		2	0/80		1	0	1	* Numeral shows block number.
										_				number.

(2) Data table

١				_							_		
	9	8	7	6	ড	4	3	2	_	0	Step No.	No. 0	Pattern
			180	When de		0	150	150	100	[2] 001	perature	Step tem-	Main program
			0:00	When desired to reach to the setting temperature(e.g. 180°C) in minimum time.		1:10	1:00	0:30	1:00	1 :00	[Hour:Min]	Step time	ogram
				ch to		-	ω	-	2	-		PI N	
			et the	the se		0	0	2	0	-	, al	E o i +	
			step	tting		-	ယ	-	2	-	11.101	Wait Alam	
			time t	temper		2	1	2	ડ	Ç1	CH 1		
			o 0 ho	ature(		w	4	0	2	0	CH 2		Blook number
			ur o m	e.g. 1							CH 3	Tim	umber
			inutes	(D,08							CH 4	Time signal	
			as 18	in min							CH 5	al	
			Set the step time to 0 hour 0 minutes as 180°C, 0:00.	imum t							CH 2 CH 3 CH 4 CH 5 CH 6 CH 7		
2	)		00.	ime.							CH 7		

In this example, up to step with time signar (uption) only thi, the are used

O PID block setting

P (\*) 2.5 [8] 350 88 D[s] 8 8 છ A[%] 38 50

> ı+ 5 +10

\*20 No. Wait block setting

Wait value [°C] 0 Alarm block setting

No. +2 E(°C) +max. +max. C) −min. —min.

Each block PID, Wait and Alarm has 10 blocks, however, example is described with 4 blocks.

[min.]

3	2	1	*40	No.
			_	ļ
0	0	30	0	OFF
75	60	30	0	ON
7	6	ហ	4	No.
		20	20	OFF
		80	20	ON
11	5	9	8	No.
				OFF
				ON
15	14	13	12	No.
				OFF
				ON N

Notes: \*1, In case of ON-OFF action, make all of PID block, Wait block and Alarm block to "O".


- \*2, When Wait is not used, it is easy if 0°C is set to No.0 block. [i.e. If 0°C is set to Wait block No.0, others also become to 0°C (no wait).]
- [i.e. If set the Alarm block as above, others also become to no alarm the same as When Alarm is not used, set the block setting of No.0 as high limit (H) maximum value and low limit (L) minimum value.
- No.0 block setting value is factory adjusted as high limit (H) to maximum value and low limit (L) to minimum value considering in case the alarm is not used. Alarm block No.0.]
- \*44, When Time signal is not used, set both ON and OFF in No.0 block to "O". [i.e. If set the Time signal block No.0 to "O", others also become to "O" (no Time

#### Shinko


PC-600 INSTRUCTION MANUAL

#### 8.3 Programming

Flow of setting mode

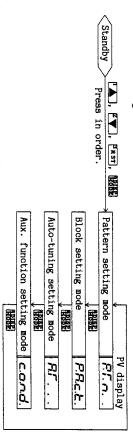

() 8.4 Flow of program pattern setting

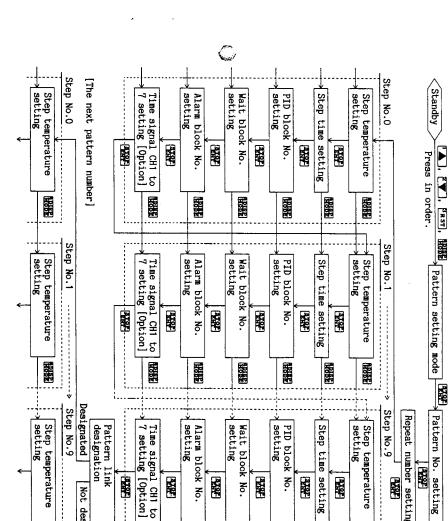

## 8.5 Setting of Program pattern

Press 🚻 key
when
P.F.O. is o
displayed.

10€	· • •	8 <b>*</b>	(*)	7	6	Ji	‡=	ω	2	_	No.
<b>)</b>	Į,	,	Advance to procedure In case Time signal	<b>(</b> ), <b>(</b> ),	<b>)</b> , <b>(</b> ),	<b>(</b> ), ( <b>(</b> ),	<b>)</b>	or	or •	or , (T),	Key operation
			rocedure signal				**************************************				ion
בי במיק היירי ביי	בי הם הייי	-22	15, in case [Option code:	- RL Ğ	ם הבאר	. bi 0	្រុក ភ្នំ ពល់លំព	20 20 20 20 20 20		Bing	Display
Input the Time signal block number to the time signal output CH3 by [], [] keys, and then press [] key.	Input the Time signal block number to the time signal output CH2 by $[\![ \Delta ]\!]$ , $[\![ \nabla ]\!]$ keys, and then press $[\![ \Sigma ]\!]$ key.	Input the Time signal block number to the time signal output CH1 by [ , [ ] keys, and then press [138] key.	the specification is standard. TS] is applied, perform the next operations.	Input the Alarm block number by [], [_] keys, and then press [132] key.	Input the Wait block number by [1], [7] keys, and then press [132] key.	Input the PID block number by [1], [7] keys, and then press [1] key.	Input the Step time by [本], 文 keys, and then press 犯罪 key.	Shows the Step number on Step number display. Input the Step temperature by [A], [V] keys, and then press [HR] key.	Shows the number of Repeat. Press THE key if the number is correct. When it should be changed, use [	Shows the Pattern number. If the number is correct press [138] key. When it should be changed, select by [14], [2] keys and press [138] key.	Description

(*) 15	11. (*)	(*) 13	(*) 12	1.*	No.
<b>(</b> , ( <b>)</b> , ( <b>)</b>		( <b>1</b> ), ( <b></b>	<b>1</b> , <b>2</b> , <b>2</b> , <b>2</b>	<b>1</b>	Key operation
0 5 2 3 3	- [ 47	- L 18	5, 1, 2	- 7.44	Display
Step number turns to 1. Input the Step temperature by [1], [7] keys, and then press [FRF] key.	Input the Time signal block number to the time signal output CH7 by $[ \_ ]$ , $[ \_ ]$ keys, and then press $[ \underbrace{XRT} ]$ key.	Input the Time signal block number to the time signal output CH6 by $\lceil \Delta \rceil$ , $\lceil \nabla \nabla \rceil$ keys, and then press $\lceil \Sigma R \rangle$ key.	Input the Time signal block number to the time signal output CH5 by $[\![ \Delta ]\!]$ , $[\![ \nabla ]\!]$ keys, and then press $[\![ \Sigma ]\!]$ key.	Input the Time signal block number to the time signal output CH4 by $[\![\Delta]\!]$ , $[\![\nabla]\!]$ keys, and then press $[\![\Sigma\!]$ Rey.	Description

Perform the same setting continuously, and up to No.9 of steps can be set. If step numbers to be used are less than 10, it is unnecessary for remaining steps to input the values 0. When correcting the patterns already set, only necessary parts as required to correct. When reducing the step number, display the unnecessary step number and then press [AR] key for 3 seconds, and setting value on and after the step number will turn to initial value.

- To return standby mode, press [新] key.
   To return the beginning of pattern setting mode, press (我被) key.

#### 8.6 Link of patterns

In case the number of steps are more than 10 in a pattern, the number of steps car increased by linking the pattern with the next pattern and then the new pattern or used. (maximum 100 steps)

After all settings of step No.9 have been finished, decide whether the patterns she linked or not.


1	2	1	No.
	(A), (ME)	¹ <b>▲</b> ], ἔ▼],	No. Key operation
	0 1859	C 481	Display
	Pattern number increases by 1, and displays Step No.0.	Display asks whether the pattern should be link or not. If linked, press [1] (displays 1) and if not, press [7] (displays 1), and then pres [7] key. (Initial value:	Description

- To return standby mode, press [REST] key.
   To return the beginning of pattern setting mode, press [RNN] key.

Shinko

8.7 Program clear
When ARY key is pressed for 3 seconds in setting mode, setting value on and after the Step number within displaying pattern turns to initial value.
Pattern link is also cancelled.

8.8 Setting of the blocks (PID, Wait, Alarm, Time signal)

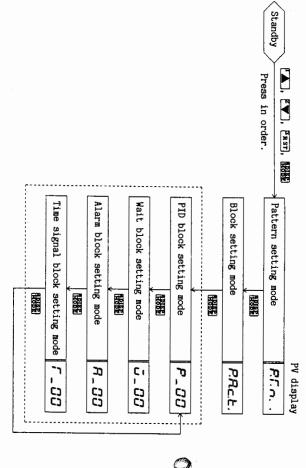

Note: Initial values of each block and setting values are adjusted as "O". Therefore, if a setting value is input to the block No.O, the setting value also becomes the input for the block not yet used.

be used so that each mode can not be operated. (In this manual, it is explained with block No.0 for convenience sake.) For example: PID block No.0 for ON-OFF action (P,I,D and ARW values "0") It is useful that each block should be used from block No.1, and block No.0 should

Wait block No.0 for Wait function not designated

(1) Setting of PID block

Press  $oxed{H} oxed{H}$  key when  $oxed{P_- UU}$  is displayed

(Block No. will be changed if (▲) or ▼▼ key is pressed.)

		z
2		No.
	PID block Tiom	Key operation
P0_i		Display
Input Integral time value of PID block No.0 by [1], [7] keys, and then press [1] key.	Input Proportional band value of PID block No.(by [], [] keys, and then press [] key.	Description

ъ	ŧ=	ω	No.
(*), (**), (***)	<b>(</b> ▼), ( <b>(</b> ▼)		Key operation
P 1 P	P0_8	PO_d Inp	Display
P /_P Input Proportional band value of PID block No DD by [▲], [▼] keys, and then press [138] key.	Input Anti-reset windup value of PID block No by [▲], [▼] keys, and then press [\$\frac{\$\frac{\fin}\finc{\frac}\fin}\firac{\frac{\frac{\frac}\fin\fir\frac{\frac{\frac{\fir\fir\fir\f{\fir\f	Input Derivative time value of PID block No.0 by 【▲, 푿▼] keys, and then press 【郑】key.	Display Description

Perform the same setting continuously, and up to No.9 of blocks can be set. It is not required to set all of the blocks, set necessary blocks only.

0

• To return standby mode, press [MIST] key.
• To return the beginning of pattern setting mode, press **Fig.** key

(2) Setting of Wait block

Press 🚻 key when  $\begin{bmatrix} \overline{J} - \overline{G} \overline{G} \end{bmatrix}$  is displayed.

(Block No. will be changed if ( a or ▼ key is pressed.)

N	_	<b>₹</b>	
	Wait block Block Number	No. Key operation	
0	Ü	Display	•
Input Wait value of Wait block No.1 by [▲], [▼] keys, and then press [¾] key.	Input Wait value of Wait block No.0 by [▲], [▼] keys, and then press [332] key.	Description	

Perform the same setting continuously, and up to No.9 of Wait blocks can be set. It is not required to set all of the blocks, set necessary blocks only.

- ·To return standby mode, press [新町] key.
  ·To return the beginning of pattern setting mode, press [孫昭] key

Shinko

PC-600 INSTRUCTION MANUAL

(3) Setting of Alarm block

Press 🚟 key when 유\_미미 is displayed

(Block No. will be changed if [▲] or [▼] key is pressed.)

שי			
erfor	2	_	N <sub>O</sub> .
rm the same setting	(*), (**), (**)	Alerm block Block Number High limit	Key operation
g continuously	HO LIBIT B		Display
Perform the same setting continuously, and up to No.9 of Alarm blocks can be set.	Input Alarm L (low limit alarm) value of Alarm block No.0 by [, < keys, and then press [XRE] key.	Input Alarm H (high limit alarm) value of Alarm block No.0 by [	Description

It is not required to set all of the blocks, set necessary blocks only.

- To return standby mode, press [FRST] key.
   To return the beginning of pattern setting mode, press [FREE] key.

Notes: 1. No.O block setting value is factory adjusted as high limit (H) to maximum value and low limit (L) to minimum value considering in case the alarm is not used.

In the case of alarm L (low limit alarm) " $RO_L$ ", it displays the value normally "499.9" up to -199.9, however, when it becomes -200.0, it displays "200.0"

"2.00.0"

It indicates the decimal point.

It means minus (-).

(4) Setting of Time signal block {Option: TS} The parts related with Program pattern an shown below. Program pattern and Time signal in "8.2 Data example" are

						_		
		TIME SIGNAL	1				paccern	
			<u>-</u>				Ste	Ste
No.	CH2 CH2	Signal	No.	CH1 CH1	Signal		Step time	Step No.
0	0/0		5	20/80 (+2)			1:00	0
2	0/60		з	0/75 (+2)			1:00	1
0	2		2	0 / 6 0			0:30	2
F	20/20 (+3)		1	0/75 (+2) 0/80 (+2) 0/30 (+3)			1:00	3
ω	0/73 (+1)		2	0/80 (+3)			1:10	ŧ

- Notes: 1. When Time signal is set with longer time than the step time, it obeys the next step setting. (\*1)
- ? When setting ON signal continued to the next step, set the ON time to If time setting is set the same as the step time, time signal momentarily turns once OFF at a change of step. exceed to the next step. (\*2)
- Time signal automatically turns OFF signal after ON time passed. (\*3)

Press 🚟 key when [ \_ 00] is displayed

(Block No. will be changed if ( a or e ley is pressed.)

<u>,</u>	3	2		(38E)	No. Key
	(A), (V), (MAE)	(A), (V), (ME	Time signal block No.		Key operation
قَفَوه	مَّمَوْن مَصْمَة	00. 00. 00.	0000 E	r_00	Display
Input ON time of Time signal block No.1 by [▲], [▼] keys, and then press [XRF] key.	Input OFF time of Time signal block No.1 by [A], [T] keys, and then press [TRE] key.	Input ON time of Time signal block No.0 by [A], [T] keys, and then press [XXV] key.	Input OFF time of Time signal block No.0 by [A], EY keys, and then press [XXV] key.	Time signal block setting mode.	Description


Perform the same setting continuously.

It is not required to set all of the blocks, set necessary blocks only.

- To return standby mode, press [RST] key.
   To return the beginning of pattern setting mode, press [RRE] key.
- (5) Setting of PID auto-tuning (AT)

Constant setting by PID auto-tuning (AT) is effective only during control. Press TEST key in the correcting mode during control when FIT o is is displ


(Program time is suspended during auto-tuning.) Auto-tuning is started at the setting value (temperature setting) when AT has t started (operation), and the setting value in PID block is rewritten. It has the influence with the other patterns which designates the block No.

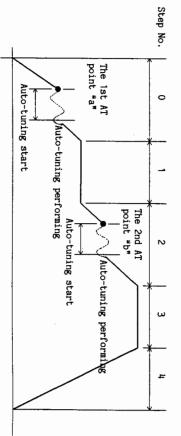

For example: In the preceding figure, the first AT is performed at "a" point. This point is in Step No.O, and PID block No.O is selected, and the value in the brock is as follows. After Auto-tuning the contents of block No.O is replaced with the value found by Auto-tuning.

The 2nd AT point "b"				ротпса	The 1st AT	PID bloc		
ARW	D	I	PID block No.0 P	ARW	D	I	PID block No.0 P	
<b>≯</b> Oħ	50 sec	200 sec	3 %	0 \$	0 sec	0 sec	0 \$	Before Al
50 🕻	20 sec	80 sec	2.4 \$	<b>1</b> 0 <b>1</b>	50 sec	200 sec	3 %	AITER AI

When executing Auto-tuning during RUN, program time is interrupted (execute AT on HOLD status) and after AT is terminated, performs the program time remaining.

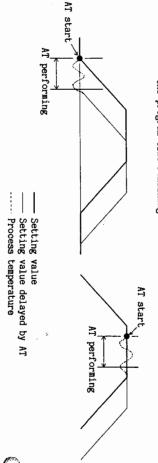

6)
Cancellation
ದ್ದಿ
PID
auto-tuning.

Press [HAP] key in the correcting mode when [FI] is displayed. It is set during PID auto-tuning.

. 70	2	_		No.
cancel the PID autoreturn the beginning	•	A.G.E.	THEFT, WHEE, WHEE	Key operation
etuning, pres	 8f	אני אני	RΓ	Display
·To cancel the PID auto-tuning, press [****] key. Then, the control will be continued to return the beginning of pattern setting mode, press [****] key.	Press 📆 key to cancel PID auto-tuning.	Press (ARR) to select PID auto-tuning setting	PID auto-tuning setting mode.	Description

8.9 Correction and confirmation of program during execution of control

Program can be corrected and called (confirmation) during control as well as the setting mode. Auto-tuning should be carried out during control.

Flow of setting mode

				Tropo III older	Standby Press in order	E S S S S S S S S S S S S S S S S S S S	
Aux. function setting mode	Auto-tuning setting mode   Af	<b>↓ (1885)</b>	Block setting mode F.R.L.	<b>1398₽</b>	Pattern setting mode P.T.A.	PV display	


The operation is the same as the setting mode (8.3 to 8.5).

Note: (1) As for correction of the number of repeat, the setting value can be corrected, however, the number of repeat during control can not be corrected.

(2) As for time division ON-OFF output, (-R/I], -S/I], -T/II) if the step is terminated at the status control output is ON, the output is

continued until the ON period

terminates.

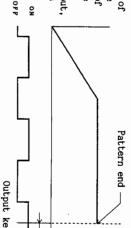

## 9. AUXILIARY FUNCTION SETTING

#### 9.1 Setting

Proportional cycle, Output high limit limiter, Output low limit limiter, Main setting high limit limiter, Main setting low limit limiter, Serial communication instrument number setting and Setting lock are settable in this Auxiliary function setting mode.

Press 🚻 key when [cond] is displayed (Auxiliary function setting mode).

	, press [AST] We of pattern s	• To return standby mode, press [485] key. • To return the beginning of pattern setting mode, press [485] key.
Specify whether all setting values (excepting pattern number) are locked or not. If locked, press [A] key, and if not, press [Y] key. SV display indicates [L] - When locked, when not lock J.	Fock	
Set the Instrument number for serial communication. Apply the number with [ , , , , , , , , , , , , , , , , , ,	Очяр	6
To change the Low limit limiter of the Main setting, input with [A], [T] keys, and then press [TRE] key. (Initial value: Minimum of the range)	אל רף	5
To change the High limit limiter of the Main setting, input with [, E] keys, and then press [FRE] key. (Initial value: Maximum of the range)	893,	14 (**). (**). (**).
To change the Low limit limiter of the output, input with [, E] keys, and then press EXE key. (Initial value:	פניק	3
To change the High limit limiter of the output, input with [A], [V] keys, and then press ERF (Initial value: 1	99,30	2 (1)
Input the Proportional cycle by [], [_] keys and then press [XAF] key.  (Initial value:In case of -R/[] 30S, -S/[] 3S.)  This item is not available for the type -A/[].	c 4c	1
	Display	No. Key operation

Notes: Press [TAMP] key at the items the setting is not required, and the item will move to the next. Proportional band will not be changed even if high limit limiter or low limit limiter of main setting is changed.

# 9.2 Setting of control output High and Low limit limiter

The high and Low limit of control output can be set from 0 to 100% (-10 to 110% for -A/ $\Box$ type). Set the most suitable value according to the heater capacity or the

processing condition. (Initial value: 100% for high limit and 0% for low limit)

### 10. FIXED VALUE CONTROL

### 10.1 Flow of setting

change the control mode.	further press (1962) key to	* If the Program lamp is lighted,	11 cos til ot det .		TA ZW SEST ADISE
Aux. function setting mode cond.	(POSE)	Auto-tuning setting mode   R	[3888]	Fixed value control mode	PV display

Note: During control (RUN lamp lights), operate the setting after pressing the **TARF** key to select the standby status.

#### 10.2 Setting

0

Press (XXX) key when [F, Y, Y, Y] is displayed. Set the values in order of Main setting. High limit alarm, Low limit alarm, Proportional band, Integral time, Derivative time and ARW.

8	7	6	υī	#	ω	2	_	No.
	[ <b>1</b> ], [ <b>7</b> ], <b>1192</b> ]	[38X] (▲] (▼]				[A], (Y), (1997)	TOP	Key operation
٦ 0	Arū a	0 0	, 0	P 00	ט אנ	0 48	d a	Display
Press [Mas] key at the termination.	Input ARW setting value by [1], [7] keys, and then press [1] key.	Input Derivative time setting value by [], [] keys, and then press [] key.	Input Integral time setting value by [1], [7] keys, and then press [1] key.	Input Proportional band setting value by [1], [7] keys, and then press [232] key.	Input Low limit alarm setting value by [] , E keys, and then press [] key.	Input High limit alarm setting value by [], keys, and then press [] key.	Input Main setting value by [1], [7] keys, a then press [1] key.	Description

#### Shinho

### PC-600 INSTRUCTION MANUAL

10.3 Setting of PID auto-tuning (AT)

Operate the setting during fixed value control.

<del></del>	2	1		No. Key
			EV, Grst	Key operation
	אנרם אר	 81.	R	Display
PID auto-tuning starts. (AT indicator blinks.) Press [Max] key at the termination.	Press [  key to set the PID auto-tuning.	Press 🚟 key.	PID auto-tuning mode.	Description

10.4 Cancellation of PID auto-tuning (AT)

\* Operate the setting during fixed value control.

					ı
ω	2			No.	
- RAT			[本], 《▼], 《RST]	Key operation	
	BUT o	- 37	A	Display	
Press (RST) key at the termination.	Press 🔽 key to cancel the PID auto-tuning.	Press (1997) key.	PID auto-tuning mode.	Description	

10.5 Setting of Auxiliary function

Auxiliary function setting of Fixed control is the same as Program control. Settable: Proportional cycle, Output high limit limiter, Output low limit limiter, Main control high limit limiter, Main control high limit limiter, Main control low limit limiter and Setting look.

Shinho

PC-600 INSTRUCTION MANUAL

#### 11. OPERATION

After setting, start the operation with following procedure

- ① Turn the power supply ON

  Turn the power supply to this instrument and to controlling circuit ON. may be changed. Do not turn the power supply on while key is pressing, or instrument specification
- ② Instrument is in warming up status

909 کتis displayed for approximately 6 seconds

Therefore, key operations must not be performed during this time. If a key is operated during this time, the instrument specifications may be changed

- ③ Pattern number setting
- Press the keys in order of [], [], [RST], [RSE] and then press [ANY] key. Input the Program pattern number to be operated with [], [] keys and then set the number with [ANY] key.
- The setting is completed if [RET] key is pressed (The instrument turns to standby situation.)
- ④ Control performance

Press (FWE) key, and the instrument starts control. (On the displays, the setting value, process variable,

etc. will be displayed.)

- ⑤ Control termination
- Pattern end output will not be generated if THE or THE key is pressed before When the execution of program has been finished, the status of instrument becomes termination and the pattern end output turns ON. program termination.

this instrument will perform the continuation of the program. If instantaneous power failure (approx. 30ms. or less) occurred and restored

control after the power failure is restored, passing the warmup status [ @ (However, if the option "Stops after power failure restored" or "Holds after power failure restored" is designated, it complys with the function designated.) If interrupted approximately 30ms or more, this instrument will continue the control after the power failure is restored, passing the warmup status [ @].

# 12. EXPLANATION OF CONTROLLING OPERATION

### 12.1 Explanation of PID

### (1) Proportional band (P)

Proportional action is the action of which the control output varies in proportion to the deviation between setting value and processing temperature. If the proportional band is narrowed, the output changes according to even by a slight variation of the processing temperature, and better control result can be obtained as the offset decreases. However, if when the proportional band is extremely far too narrowed, it may cause variation in the processing temperature even by slight disturbance, and turns into control such as ON/OFF action of the so called hunting phenomenon. Therefore, when the processing temperature comes to the balanced position near the

#### (2) Integral time (I)

Integral action is to eliminate offset. When the integral time is shortened, the returning speed to the setting point is quickened. However, the cycle of oscillation is also quickened and stability becomes unfavorable.

setting value and a constant temperature is maintained, the most suitable value is selected by gradually narrowing the proportional band while observing the control

### (3) Derivative time (D)

Derivative action is to restore the change of processing temperature according to the changing rate. It reduces the amplitude of overshoot and undershoot width.


If the derivative time is shortened, restoring value comes small, and if the derivative time is adjusted longer, a phenomenon of returning too much may occur and the control system may be oscillated.

# 12.2 PID auto-tuning of this instrument


In order to decide each value of P, I, D and ARW automatically, this system gives the fluctuation to the control object by force. Three kinds of undermentioned systems are automatically selected by an instrument.

 In case the difference between setting value and the processing temperature is large when the temperature rises.


Fluctuation is given at the temperature 2.5% of scaling span lower than the setting value.

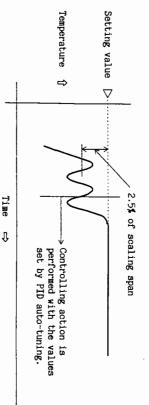

(2) In case of the stable situation during control or the control temperature is wit  $\pm 5\%$  of scaling span: The fluctuation is given at the setting value.

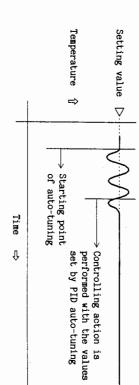

(3) When the control temperature is 5\$ of scaling span higher than the setting value. The fluctuation is given at the temperature 2.5\$ of scaling span higher than the setting value.

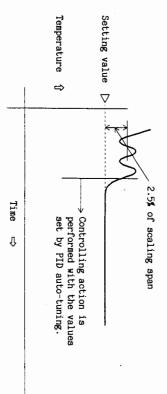

14. SPECIFICATIONS

12.3 Explanation of ARW (Anti-reset windup)
ARW prevents overshoot caused when responding the step. It is set automatically using PID auto-tuning. If operating by manual, duty factor of load for the setting is of standard value, to fix controlling aim.

Duty factor is get as follows.

In case of SSR output and SSR driving output:

Duty factor (
$$\sharp$$
) =  $\frac{ON \text{ time}}{Proportional cycle} \times 100$ 

In case of Current output:

Duty factor (
$$\sharp$$
) =  $\frac{\text{Output current value } (\pi A) - 4}{16} \times 100$ 

Set 50%, if duty factor is unknown

## MAINTENANCE AND CHECKING

The external factors when the controller acts malfunction are shown below:

Influence of inductive fault or noise. AC leaks into thermometer detector. Wrong connection of terminals.	Unstable	Unstable display	
Short circuit of thermocouple or RTD. Wrong installation (insertion) of thermocouple or RTD. Reverse polarity of thermocouple or compensating lead wire. Wrong (low) specification of PTD.	CONT lit	Displays (—) or around O.	Temperature rises too much
Burnout or improper connection of heater. Troubles of electromagnetic switch or control device such as trigger.	CONT lit	Displays the room temperature	does not 1 196.
Burnout of thermocouple, compensating lead wire or RTD.  Improper connection of input terminal.	CONT unlit	Displays far above the setting value	Temperature
Presumed trouble	Indicator	Status of instrument Digital display Indic	Phenomenon

14.1 Standard specifications Action display accuracy Display Time indicating accuracy Temperature indicating < Indicating section > : Control : Digital display with LED.
PV value (Actual tempe : Within ±0.3% of full scale ±1digit. Within ±0.1% of setting time. Statuses actions Step No. SV value Pattern **∾** At [HOLD] At [AT] At [ALM] ON Red LED lights. At [PROG, FIX, RUN, TIME or MV] At [CONT] ON Green LED lights. (Setting temperature, Setting time, (Actual temperature and Characters) Red, Green, Figure size 8mm ×4mm Green, Figure size 14.3mm ×8mm Remaining time or Manipulating value) (-A/[]type, blinks correspond to output)
[ALM] ON Red LED lights. Figure size Figure size 14.3mm ×8mm Red LED lights. Red LED blinks. Yellow LED blinks 8mm × 4mm

< Program control section >

Operation system Setting : By front face function keys Optional functions \* Time By function keys Auxiliary functions Wait \* Program pattern No. \* Number of Repeat Temperature alarm Proportional cycle Setting value lock Main setting high limit limiter Main setting low limit limiter Output high limit limiter Output low limit limiter Temperature \* Step No. \* PID block RST (Reset)
(Fix/Hold)

(Increase) [▼] (Decrease)

£ ....

配號 (Mode/Display) 函数 (Program/Run) 部 (Clear/Advance) 部 (Entry/Stop)

Number of Steps Number of Patterns 10 steps/ pattern (Total 100 steps) 10 (Linkable)

Number of Repeat 9999 times

Program time range : 0 to 99 hours 59 minutes/step

Setting resolution Time setting accuracy : Within ±0.1% of setting time : Temperature Refer to the [Rated scale table]

1 minute

< General specification >

Pattern end output Temperature alarm Control output Temperature setting Main control action < Controlling section > : Outputs when the program is terminated. : -R/[] Relay contact lc AC 220V 3A (resistive load) : PID action (with Auto-tuning function) : Within ±0.3% of full scale ±1digit Deviation setting against main setting. Set by selection from 10 blocks (No.0 to 9)  $\,$ Output, relay contact 1a Action, ON-OFF action Dead band (hysteresis)  $2^{\circ}\!\mathrm{C}$  The low limit side is prevented until the input -S/[] Non-contact voltage (for SSR drive) Isolated DC 15  $\pm 3V$  Load resistance 1.5k $\Omega$  -T/[] Non-contact relay (SSR output) Isolated Setting range, High limit alarm, from (-) Maximum scale Anti-reset windup, 0 to 100% (ARW) Integral time, 1 to 3600sec. variable (off when set to 0) Derivative time, 1 to 1800sec. variable (off when set to 0) Proportional cycle, 1 to 120sec. variable Output limiter, Wait temperature, -A/| Current Proportional band: 0.1 to 200.0% variable automatically tuned. Proportional band, Integral time, Derivative time and ARW Relay contact, 1a  $\times 2$  capacity, AC 220V 0.5A (resistive AC 220V 0.2A (inductive capacity, AC 220V 0.5A (resistive load) temperature comes higher than the alarm setting temperature. (However, -10 to +110% for -A/[] type, and 4 to 20mA of the value correspond to 0 to 100%) (Sets the high limit and low limit of control output) (20mA < Exciting current of AC electromagnet relay < 1A) Low limit alarm, 0 to 100% ±(1 to 100)°C DC 4 to 20mA (in proportional band) Isolated, Load resistance max.  $600\Omega$ AC 220V 1A (inductive load  $\cos \phi = 4$ ) AC 220V 1A (Not available for current output) (ON-OFF action when set to 0.0) from (—) Maximum scale to (+) Maximum scale width (+) Maximum scale width load) load  $\cos \phi = 0.4$ ) (off when set to 0) are

> Input Power failure Voltage fluctuation Power supply Mounting Ambient temperature Rated scale : With power failure protecting function. : -0/E : Refer to [Rated scale table]. : Flush 0 to 55°C Allowable  $\pm 10\%$  of rated voltage AC 110/220V, 50/60Hz DC voltage DC current Thermocouple K, J, R, B and S (specified) below 100 \Omega RT (Multi-range system only for -[]/E) Pt100 3-wire system DC 0 to 1V DC 4 to 20mA (Resistance per wire less than  $4\Omega$ )

Color Weight Power Consumption Ambient humidity Materials : Front frame: Light gray, Case: Light gray : Approx. 800g : 35 to 80%RH (non-condensing) Approx. 5W Front frame: Resin, Case: Resin

Insulation resistance: 10M $\Omega$  or more at DC 500V (However, the voltage must not be appearance). to the terminals between input and

Auxiliary function Dielectric strength : Between Input terminal and Ground terminal, AC 500V for 1 mir Between Power terminal and Ground terminal, AC 1.5kV for 1 mir Power failure countermeasure (Data memories are backed up with

Burnout Automatic cold junction temperature compensator -U/E (up-scale) lithium battery for 5 years or m

[Rated Scale Table]

:						
,	0 to 1600°C	0 to 1200°C	0 to 800°C	J.004 04 0	Scale range	
•	1°C	1°C	1°C	1°C	Resolution	
	T/C R, S	T/C K	T/C K, J	T/C K, J	Input	
	0 to 100.0	0 to 100.0	-100.0 to 400.0°C	J.0081 of 0	Scale range	
	0.1	0.1	0.1°C	1°C	Resolution	
	DC 4 to 20	DC 0 to 1V	RTD Pt100	T/C B	Input	

Note: With B type of thermocouple input, the accuracy guarantee range is 300 to 1800

14.2 Optional specifications ([ ]: Optional code)

Setting value display :. [SS] Step temperature setting value display. Displays the Step temperature (temperature setting

programmed on SV display.

<u>⊊</u> Cooling control action.

OFF in the range in which the input value is lower the setting value, ON in the range in which it is

Control action

Alarm setting : [AA] Process value alarm setting.

than that.

High limit alarm with high limit standby function.

.: [N] Low limit alarm without low limit standby function

Alarm action

И	
-	
2	
7	
6	
_	

### PC-600 INSTRUCTION MANUAL

			External
			operating
			function:
			[EC]
(ADV) Interrupts the program step performing and shifts it to the next.	(STOP) Terminates the program performing. (HOLD) Suspends the progress of program time performing.	or open collector.  (RUN ) Starts the control of program or cancels the Hold.	External operating function: [EC] Following functions can be operated by closing contact

Time signal output

: [TS] The time signal block (OFF time and ON time of the signal) The same number can be designated many time by selecting any number from 16 kinds of time signal blocks which have already been set in advance. Maximum 7 channels can be is set per step.

used per step.
Number of circuit: 7, Output: Open collector, Capacity: DC 24V, max. 50mA

Transmitting output

: [PVT] Process variable (actual temperature) transmitting output DC 0 to 1V or DC 4 to 20mA [SVT] Setting value transmitting output DC 4 to 20mA (max. load resistance 600Ω) or DC 0 to 1V

Serial communication

•• [C,C5]The following operations can be carried out from the external computer.

Registration and correction of program

4. Reading of action status Reading of program
 Operation of RUN, STOP, HOLD, ADVANCE, etc.

Communication system, Half-duplex synchronous Communication line, EIA RS-232C [C] or RS-485 [C5]

Baud rate, 2400bps (changeable to 1200, 4800 and 9600bps) start-stop system

Data configuration, Start bit : 1 bit
Data bit : 7 bits Parity bit: Even number Stop bit : 1 bit

Automatic start

[AST] After the power turned ON, the program automatically starts at once. (Input with [ANN] key is not required.)

[PST] Begins the program start at process variable.

Power failure restoring

PV start

: [PS] Turns to standby status after the power failure restored. [PRH] Performs the program at the time of power failure, after restored the power failure and turns to Hold status.

Shirks

PC-600 INSTRUCTION MANUAL

#### 15. CHARACTER TABLE

Character	Description	Character	Description
נינין בי הלק	Warming up status	£	PID auto-tuning setting
	[Program control]	H.	auto-tuning
P.F.0	Pattern setting mode	)	ing set o
المرام	Pattern number	70,00	Auxiliant function
1631	Number of repeat	כיסיטש	Reportional avala
1870	Step temperature	-   n	high
32 13	Step time	٦   ٦	) TIEL 119111
- P 19-	PID block number setting	- ا ر-	Output low limit limiter
ייאר	Wait block number setting	ר היי	1011
ר שר יי	Alarm block number setting	ייי רר	Section 10 times
147	Time signal CH No. setting(No.1)	007	number setting
1845	Pattern link setting	tock	Setting value lock
c) *	No pattern link specified	· ·	value lo
*	Pattern link specified	7	Setting value lock designa
P.R.c.E.	Block setting mode		alue co
P_00	PID block setting mode	E) U	Setting mode
4 - Bd	Prop. band (PID block No.0)		
PQ_1	Integral time (PID block No.0)	48	High limit alarm
P <u>0</u> _d	Derivative time (PID block No.0)	S	
P <u>0</u> _R	ARW (PID block No.0)	ם מ	Proportional band
ŭ_00	Wait block setting mode		Integral time
בְּטֵ-	Wait value setting (block No.0)	).	
8_00	Alarm block setting mode	מ נ	Anti-reset windum (ARW)
4 <u>0</u> -7	High limit alarm (block No.0)	actors	֓֞֟֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓
1 <u>.</u> 08	Low limit alarm (block No.0)	מייים מייים	
1-00	Time signal block setting mode	, (	רטיי יטיר
20_€	OFF time(Time signal block No.0)	are the same	meaning
00-0	ON time (Time signal block No.0)	{	0
Hambad by t	those characters are displayed a	the our dia	plan (Cross IED) and other

Marked by \*, these characters are displayed on the SV display (Green LED), and other on the PV display (Red LED). Numbers underlined indicate the block Nos. or channel No

16.	
MULTI-RANGE	
FUNCTIO	

MULTI-RANGE FUNCTION 8 kinds of range are applicable for Thermocouple type of controller (U/E) with this function. (Range No.0 to 7)

															Standby	
															A, Call, TIX, CENT	HOLD
															$\downarrow$	STOP
(Standby status)	Control performing		0 to 1800°C B		0 to 1600°C S	0 to 1600°C R		0 to 1200°C K		0 to 800°C J	0 to 800°C K		0 to 400°C J	0 to 400°C K	Multi-range mode	
cus)	orming	<b>₽</b> RST	า An G		s rAnG	1 Bou		· rAnt		r An G	C Bot		r Rot	า A n C		STD AJ
	:		כי	<b>Y</b>		כז	4		<b>4</b>	כי	כז	4	כיז		7	ry display by display
	:				0	7		T		W				<i>C</i>	:	Pards

Note: When switching the multi-range, the multi-range number should not be more than 8. With B type of thermocouple input, the accuracy guarantee range is 300 to  $1800^\circ\mathrm{C}$ .

[°C]	Setting	2	Step number	(1) Program pattern (Pattern No. )
		>		
				-

Shinho

PC-600 INSTRUCTION MANUAL

	-		Time signal			
signal CH7 No.	signal CH6 No.	signal CH5 No.	signal CH4 No.	signal CH3 No.	signal CH2 No.	signal CH1 No.
						-
-						-

	<b>.</b>														
3 2 1 0 P	) PID blo	9	8	7	6	5	4	ω	2	1	Start	Step No.	No.	Pattern	(2) Dat
P[\$] I[8] D[8]	O PID block setting										_	. perature	Step tem-	Main program	(2) Data table
A (%)				:								[Hour:Min]	Step time	ogram	
3 2 1 0.	⊚ Wa											;	PID		
	it blo												Wait		
Wait value [°C]	Wait block setting											1141	Alarm		
e [°C]	ting											CH 1			
	j											CH 2		Block number	
3 2 1 0 No.	© A1												Tin	umber	
H[°C]	O Alarm block sett											CH 3 CH 4 CH 5	Time signal		
	ock se											요 5	al		
7,1°C	tti									_		유			

2	_	0	No.	O Time
			OFF	signa
			NO	signal block setting
				k sett
6	5	±	No.	<u></u>
			OFF	Settable only
			ON	
				when
10	9	8	No.	option
			440	desig

Block No.

Alarm Wait PID

15	14	13	12	ON No.	ignated.)
15	14	13	12	_	
				OFF	